

BUILDING INSPECTION REPORT

by

NATIONAL INSPECTION SERVICES

Residential

*Mailing Address: P.O. Box 270104
Fort Collins, Colorado 80527-0104*

(970) 484-1313

Fax 970-669-1546

Email: Dave@National-Inspection.com

www.national-inspection.com

**INSPECTION ADDRESS: 1814 Rollins Gate Road
Fort Collins, Colorado**

CUSTOMER: Todd and Tricia Lambert

INSPECTION DATE: June 12, 2010

**THIS REPORT IS CONFIDENTIAL AND IS THE PROPERTY OF THE CUSTOMER NAMED HEREIN.
ANY OTHER USE OR REPRODUCTION IS UNAUTHORIZED.**

© Copyright 2010
NATIONAL INSPECTION SERVICES
Synergy Enterprises, Inc.



THIS REPORT CONTAINS OUR OPINION AND WE CAUTION YOU THAT YOU MAY AND WILL LIKELY RECEIVE VARYING OPINIONS FROM DIFFERENT INSPECTORS, APPRAISERS, ARCHITECTS, LAWYERS, EXPERTS, RELATIVES, ENGINEERS, INSURANCE ADJUSTERS, REMODELING AND REPAIR CONTRACTORS, PRIVATE OR PUBLIC PERSONNEL, TRADES PEOPLE OR OTHER PARTIES WHOSE INTERESTS ARE DIFFERENT FROM OURS. THIS REPORT IS THE WORK PRODUCT OF A COLORADO CORPORATION, UNDER WHOSE AUTHORITY NATIONAL INSPECTION SERVICES OPERATES.

BUILDING INSPECTION REPORT

NATIONAL INSPECTION SERVICES

Residential

FORT COLLINS, COLORADO

It is our intent to supply you with an unbiased report and to observe that which the average prospective real estate purchaser may overlook. This report is based on a visual inspection only, at your request, in easily accessible areas, using normal operating controls and without the use of tools or testing devices, therefore, we cannot and do not guarantee that defects, whether structural, mechanical, or otherwise do not exist. This report constitutes a condition survey only, is not intended to be exhaustive, and is not a warranty. Any attached documents or addenda, whether printed or written, whether contractual or informational, shall be considered a part of this report. It is recommended that any deficiencies and the components/systems related to these deficiencies noted in the report be evaluated/inspected and repaired as needed by licensed contractors/professionals PRIOR TO THE CLOSE OF ESCROW. Further evaluation PRIOR to the close of escrow is recommended so a properly licensed professional can evaluate our concerns further and inspect the remainder of the system or component for additional concerns that may be outside our area of expertise or the scope of our inspection. Performance standards are based solely on the knowledge and experience of the inspector and therefore are not legally binding and are specifically excluded as being covered in our agreement to perform this inspection. Only those items discussed in this document were inspected and NONE OTHER. This report is written to meet or exceed our understanding of the minimum requirements of the ASHI Standards of Practice. Please call our office for any clarifications of further questions.

GENERAL INFORMATION:

DESCRIPTION OF THE STRUCTURE:

Structure Type:	Detached single family residence, 2-story
Approximate Year Built:	1997
Foundation Type:	Basement (unfinished)

Inspection Information:

Report number:	N3488
Time started / finished:	9:00 12:00
Present during inspection:	Buyers and Buyers' Realtor
For reference, front of house faces:	South
Ground condition:	Damp
Weather:	Raining with mild temperatures

THE SCOPE OF THE INSPECTION

The Inspection was a limited visual examination of certain readily accessible systems and components using normal operating controls and opening readily openable access panels. The purpose of the Inspection was to provide the Customer with information about the condition of certain systems and components of the property at the time of the Inspection. The Inspection was performed in accordance with the Standards of Practice of the American Society of Home Inspectors (ASHI), a copy of which is available from us upon written request and was available for review by you prior to accepting our services. The ASHI standards are hereby incorporated by reference in their entirety and are hereby made a part of this Agreement. All terms used herein and not otherwise defined have the meaning set forth in the ASHI standards.

The inspector is a generalist and is not a licensed engineer or expert in any specific craft or trade. If the inspector recommends further action, including (but not limited to) consulting with a specialized expert(s), you must do so at your expense or otherwise assume all risks associated with failure to do so. The inspection was not technically exhaustive. The fee charged for this inspection was substantially less than that of a technically exhaustive inspection.

This written inspection Report describes the following systems and components: foundation, heating, electrical, plumbing, air conditioning, living areas, architectural features, bedrooms, kitchen, fireplace, bathrooms and laundry room, attic, exterior, grading, roofing, roof drainage, chimneys and garage. Should we, as a courtesy, exceed any particular requirement set forth herein in one area, we shall not be obligated to exceed the requirements of other areas.

FOUNDATION:

Evidence of water within <input checked="" type="checkbox"/> basement:	No
Method of inspection:	Area entered
<input checked="" type="checkbox"/> Basement floor construction:	Concrete
Insulation in unfinished areas:	Yes – foundation walls and rim joist
Ventilation means:	Windows
Vapor barrier, interior:	Yes
<input checked="" type="checkbox"/> Basement condition:	Satisfactory
Foundation Type:	Poured concrete
Foundation Condition:	Satisfactory – inspection limited by foundation wall cover
Main floor structure:	Joists size: 2" x 10" Spacing: 16" o.c.
Sills:	Not visible
Main carrying beams or walls:	Size: 4" x 10" Material: Wood beams
Support under beams or walls:	Steel posts on concrete pads

Remarks:



1. Cracking evident in the concrete slab floor. These cracks do not appear to be indicative of a chronic or degenerative condition but require monitoring.



Crack in concrete slab floor



HEATING:

Heating Fuel:	Natural gas		
Type:	Forced hot air		
Distribution:	Metal ducts		
Main fuel shut-off location:	On supply line		
Condition of <input checked="" type="checkbox"/> furnace	Satisfactory		
Operating Controls:	Yes		
Automatic safety controls:	Yes		
Humidifier:	Yes	Condition:	Satisfactory
Apparent carbon monoxide leaks:	No		
Apparent fuel gas leaks:	No		
Approximated age of system:	13 years (based on its S/N: EH5D707F099704053) Manufacturer: Rheem Manufactured date: none given on the data plate		
Furnace filter size:	24x24x1		
Manufacturer's recommended heat rise:	50°- 80° F		
Actual furnace heat rise:	57.2° F = within the manufacturer's stated parameters		
Maximum air temperature per manufacturer's data plate:	190° F		
Actual furnace maximum air temperature:	127.9° F = within the manufacturer's stated parameters		
Furnace requires normal servicing:	No		

Remarks:



ELECTRICAL:

Electrical service:	Location: Underground	Amperage: 200
	Conductor material: Aluminum	Voltage: 120/240
Main service disconnect location:	At exterior service equipment cabinet	
Ground cable	Yes	
Type of overload protection:	Circuit breakers	
Number of Circuits	26	
Condition of main panel or primary panelboard:	Satisfactory	
Location of main panel or primary panelboard:	Garage	
Accessibility of main panel:	Satisfactory	
Main panel rating:	Satisfactory	
Compatibility of overload protection with conductor size:	Adequate	
Wiring methods:	Non- metallic sheathed cable	
Branch conductor materials:	Copper & Aluminum	
Solid conductor aluminum wiring:	No	
Polarized and grounded receptacles:	Yes	
Locations of protected circuits: <i>If "NO" see remark below.</i>	Bath – yes	Kitchen – yes Utility Sink – N/A
	Garage – yes	Exterior – yes Jetted tub – N/A
	Hot tub (exterior) – N/A	
	AFCI – None	
Representative number of switches, fixtures, and receptacles operated:	Yes	
Smoke Detectors present and performed a non-invasive, audible test only:	Yes	
Carbon Monoxide Detector(s) present but did not performed a non-invasive, audible test:	Yes	
Other built-in electrical equipment:	Security system – not evaluated through operation	
Sub-panel or secondary panelboard condition:	No sub-panel present	


Remarks:



PLUMBING:

Type of water supply lines:	Copper
Water pressure and functional flow:	Adequate
Type of waste/vent lines within the house:	Plastic
Fixtures/faucets:	Satisfactory
Main water shut-off valve condition:	Satisfactory
Main water shut-off location:	Near water heater
Overall condition of plumbing:	Satisfactory
Hot water energy source:	Natural gas
Apparent carbon monoxide leaks:	No
Overall condition of water heater:	Fair – see Remark #2
Water heater main fuel shut-off location:	On supply line
Water heater size:	50 gallon
Approximated age of water heater:	13 years (based on its Serial Number: GK97-3836467-K32) Manufacturer: AO Smith Manufactured date: none given on the data plate

Remarks:

-  2. The water heater was functional; however, rust was evident, which is problematic in that rusting tanks are prone to leakage. Based on industry standards, water heaters of this approximated age are considered nearing or at the end of their service life. I recommend monitoring for future leaks or proactive replacement.



Rust was evident at water heater



AIR CONDITIONING SYSTEM:

Energy source / type:	Electric
Type:	Exterior condenser unit
Estimated tonnage:	Unable to determine – see Remark #3
Cooling equipment, condition:	Satisfactory
Central cooling:	Yes
Temperature splits:	Return air: 74.6° F Supply air: 55.1° F
AC unit cooling:	Adequate per industry protocol
Presence of cooling source in each habitable room:	Yes
Approximate age of system:	Unable to determine age – see Remark #3 Manufacturer: Rheem Manufactured date: manufacturer's data plate absent
Operating Controls, condition:	Satisfactory

Remarks:



3. Representation about the specifics of the air conditioning system cannot be made since the manufacturer's data plate was absent from the exterior condenser. I recommend further evaluation of the air conditioning system by a qualified contractor.

LIVING AREAS:

Living room:	Located on the main level and in satisfactory condition
Dining room:	Located on the main level and in satisfactory condition
Study / Office:	Located on the main level and in satisfactory condition
Halls:	Satisfactory condition
Family room:	Located on the main level and in satisfactory condition

Remarks:



ARCHITECTURAL FEATURES:

Walls:	Structure: Wood	Condition: Satisfactory
Ceilings:	Structure: Wood	Condition: Satisfactory
Floors:	Structure: Wood and concrete	Condition: Satisfactory
Counters and cabinets	Condition: Satisfactory	
Windows:	Type: Double pane, vinyl covered wood-framed	Condition: Fair – see Remarks #5a and #5b
Doors:	Condition: Fair – see Remarks #6 and #7	
Attached porches and balconies:	Condition: Satisfactory	
Decks	None	
Steps:	Condition: Satisfactory	
Railways:	Condition: Satisfactory	
Stairway stability:	Condition: Satisfactory	
Concrete patio, walks and driveway:	Condition: Fair – see Remark #8	

Remarks:



4. Wall in family room displays cracking, which appears to be inconsequential and does not appear to be a chronic or degenerative condition.



- 5a. Peeling and/or worn paint is evident a number of interior window frames, resulting in exposed wood; which require sanding, priming and re-painting.



- 5b. Some window latches (i.e., Bedroom 4 and the living room) did not operate as intended, which require an adjustment or repair.



6. Door to office did not latch as intended, which requires an adjustment.



7. Double-keyed deadbolts are egress safety obstacles. During an emergency, a safety hazard would occur if the key was not available. Alternatively, consideration should be given to replacing the current double-keyed deadbolt at the laundry room door leading to the garage with a thumb-latch style deadbolt, which doesn't require a key to unlock from the inside, to improve emergency egress.



8. Driveway, front walkway, and front step display cracking. These cracks may be the result of swelling soil heaving or, alternatively, localized settling due to improper compaction of backfill. These cracks should be caulked to prevent access for water that accelerates the rate of heaving or settlement damage.

Architectural Features section continues on next page ...



Visit our website, <http://www.national-inspection.com/concreteproblems.html> for our article entitled: **“Concrete Problems: Crumbling, Cracking, Settling, Heaving and Stains”** for further information about concrete issues.





PHOTO PAGE: ARCHITECTURAL FEATURES




Peeling paint on interior window frame



Latch in Bedroom 4 did not operate as intended



Crack in family room wall

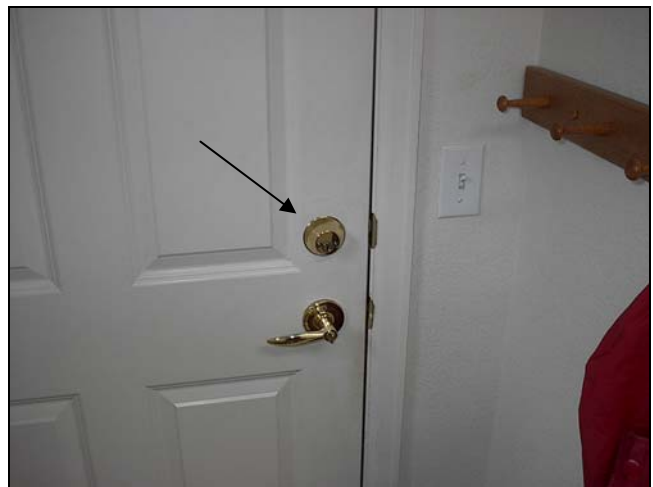

Double keyed deadbolt



Crack in front walkway



BEDROOMS:

Bedroom 1: (Master)	Location: Upper level	Condition: Satisfactory
Bedroom 2: (North)	Location: Upper level	Condition: Satisfactory
Bedroom 3: (SW)	Location: Upper level	Condition: Satisfactory
Bedroom 4: (South)	Location: Upper level	Condition: Satisfactory

Remarks:

KITCHEN:

Ventilation:	Window present: Yes
Exhaust fan:	Yes Type: Recirculating
Dishwasher:	Yes Operated and performed satisfactorily
Disposal:	Yes Operated and performed satisfactorily
Range:	Yes Operated and performed satisfactorily
Overall condition of kitchen:	Satisfactory

Remarks:



FIREPLACES OR STOVES:

Damper present:	No
Flue condition:	Satisfactory
Fire chamber condition:	Fair – see Remark #10
Location:	Family room
Type:	Glass enclosed natural gas
Apparent carbon monoxide leaks:	No
Apparent fuel gas leaks:	No
Overall fireplace condition:	Fair

Remarks:



9. The fuel source for the fireplace was off at the gas control knob, which was in the off position, rendering this appliance non-functioning. Processing any inoperable system is beyond the stated Scope of this Inspection, including the lighting of pilot lights. However, as a courtesy, I exceeded this constraint and manually activated the fireplace, per manufacturer instructions, to perform an evaluation of this appliance during normal operation. My observations are duly noted. After the inspection of this appliance was completed, its gas control knob was returned to the off position.



10. Soot and oxidation, i.e. whitish-brown residue evident on inside of the fireplace glass, may be indicative of a venting issue or incomplete combustion, which is a potential health safety hazard. This fireplace glass requires cleaning to manufacturer detail and the unit requires further evaluation by a qualified fireplace specialist.



Soot and oxidation evident



BATHROOMS AND LAUNDRY:

Bath 1: (Master)		Type: Full	Location: Upper level
	Ventilation:	Window present: Yes	
		Exhaust fan: Yes	Vented to exterior: Yes
	Overall condition:	Satisfactory	
Bath 2:		Type: Full	Location: Upper level
	Ventilation:	Window present: No	
		Exhaust fan: Yes	Vented to exterior: Yes
	Overall condition:	Satisfactory	
Bath 3:		Type: ½	Location: Main level
	Ventilation:	Window present: No	
		Exhaust fan: Yes	Vented to exterior: Yes
	Overall condition:	Satisfactory	
Bath 4:		Type: ¾	Location: Lower level
	Ventilation:	Window present: No	
		Exhaust fan: Yes	Vented to exterior: Yes
	Overall condition:	Satisfactory	
Laundry:			Location: Main level
	Ventilation:	Window present: No	
		Exhaust fan: No	Vented to exterior: N/A
	Overall condition:	Satisfactory	


Remarks:




ATTIC:

Method of inspection:	Areas entered; however, see Remark #12 ⁽²⁾
Adequate ventilation:	No – see Remark #11
Easily accessible:	Yes; however, see Remark #12
Location of access panel:	Bedroom 3 and Garage
Vapor barrier present:	No
Insulation present:	Yes
Insulation type:	Fiberglass loose fill Fiberglass batts
Insulation levels:	Average levels: 14-16 inches Adequate
Framing type:	Trusses
Framing condition:	Satisfactory
Sheathing / Decking type:	OSB
Sheathing / Decking condition:	Satisfactory
Conditioned surfaces with no insulation evident:	No
Evidence of water penetration:	No

Remarks:

-  11. Improperly vented attics contribute to shorten life of some roofing and cladding materials due to high attic temperatures and can trap humidity that penetrates the attic or siding from within the house. This condition can also cause structural damage, roof shingles to buckle, insulation to lose its effectiveness and create an environment that is conducive to fungus-like substances. In this instance, baffles that maintain an air space between the insulation and the underside of the roof sheathing are absent and/or insulation is preventing proper venting. Adjustments are recommended.

-  12. Access to the attic area above the master bathroom was restricted because of this home's roof construction style. Therefore, this component and its features may possess latent defects that were not detected during the inspection, and they may not. In this instance, the full extent of the condition of this structural component cannot be determined from this limited visual inspection.



Access to the attic area above Bath 1 was restricted



EXTERIOR:

Exterior walls, type:	Composition and brick
Overall condition:	Satisfactory
Exterior vegetation affecting building:	No
Exterior bibcocks, i.e. faucets, operating:	Yes

Remarks:

GRADING:

Front:	Adequate
Rear:	Adequate
Sides:	Adequate
Retaining walls present:	None

Remarks:



ROOFING:

Roof type and material:	Gable	Asphalt composition
Material type, Layers and Approximated age of roof:	High profile	1 layer ~13 years old
Method of inspection:	From ground – see Remark #13	
Flashing and joints condition:	Unable to adequately determine – see Remark #13	
Roof vents condition:	Unable to adequately determine – see Remark #13	
General condition of roof:	Unable to adequately determine – see Remark #13	
Soffits and fascias condition:	Satisfactory	
Skylights and other roof accessories:	None	

Remarks:



13. Roof was wet with rain at time of the inspection, which created a potentially unsafe condition for the inspector; and pursuant to ASHI inspection standards and the Scope of Inspection agreement, the roof was unable to be accessed. Consequently, representation about the condition of the roof and its related components cannot be made.

ROOF DRAINAGE:

Drainage type:	Galvanized
Adequate number of downspouts:	Yes
Adequate extensions:	Yes
Adequate splash blocks:	None
Overall drainage system condition:	Satisfactory

Remarks:



CHIMNEYS:

Furnace and water heater chimney type:	Plastic (furnace) and metal (water heater) chimneys
Furnace and water heater chimney condition:	Satisfactory
Fireplace chimney type:	Metal insulated chimney
Fireplace chimney condition:	Satisfactory

Remarks:

GARAGE:

Garage with continuous firewall separation to house:	Yes
Garage type:	Attached
Garage size and door style:	3 car 1 double and 1 single overhead doors
Electric door opener with photoelectric eyes and auto reverse:	Yes
Overall condition of garage:	Satisfactory

Remarks:



HIGHLIGHTS and SUMMARY:

This "Highlights and Summary" page is provided to allow the reader a brief overview of the report. This page is not encompassing, mutually exclusive and is not intended to indicate degree of importance. Reading this page alone is not a substitute for reading the report in its entirety. The entire Building Inspection Report, including the report Addendums, Scope of Inspection, limitations, and pre-inspection Authorization must be carefully read to fully assess the findings of the inspection. This list is not intended to determine which items may need to be addressed per the contractual requirement of the sale of the property.



1. Cracking evident in the concrete slab floor. These cracks do not appear to be indicative of a chronic or degenerative condition but require monitoring.



3. Representation about the specifics of the air conditioning system cannot be made since the manufacturer's data plate was absent from the exterior condenser. I recommend further evaluation of the air conditioning system by a qualified contractor.



4. Wall in family room displays cracking, which appears to be inconsequential and does not appear to be a chronic or degenerative condition.



- 5a. Peeling and/or worn paint is evident a number of interior window frames, resulting in exposed wood; which require sanding, priming and re-painting.



- 5b. Some window latches (i.e., Bedroom 4 and the living room) did not operate as intended, which require an adjustment or repair.



6. Door to office did not latch as intended, which requires an adjustment.



7. Double-keyed deadbolts are egress safety obstacles. During an emergency, a safety hazard would occur if the key was not available. Alternatively, consideration should be given to replacing the current double-keyed deadbolt at the laundry room door leading to the garage with a thumb-latch style deadbolt, which doesn't require a key to unlock from the inside, to improve emergency egress.




8. Driveway, front walkway, and front step display cracking. These cracks may be the result of swelling soil heaving or, alternatively, localized settling due to improper compaction of backfill. These cracks should be caulked to prevent access for water that accelerates the rate of heaving or settlement damage.





9. The fuel source for the fireplace was off at the gas control knob, which was in the off position, rendering this appliance non-functioning. Processing any inoperable system is beyond the stated Scope of this Inspection, including the lighting of pilot lights. However, as a courtesy, I exceeded this constraint and manually activated the fireplace, per manufacturer instructions, to perform an evaluation of this appliance during normal operation. My observations are duly noted. After the inspection of this appliance was completed, its gas control knob was returned to the off position.



10. Soot and oxidation, i.e. whitish-brown residue evident on inside of the fireplace glass, may be indicative of a venting issue or incomplete combustion, which is a potential health safety hazard. This fireplace glass requires cleaning to manufacturer detail and the unit requires further evaluation by a qualified fireplace specialist.

-  11. Improperly vented attics contribute to shorten life of some roofing and cladding materials due to high attic temperatures and can trap humidity that penetrates the attic or siding from within the house. This condition can also cause structural damage, roof shingles to buckle, insulation to lose its effectiveness and create an environment that is conducive to fungus-like substances. In this instance, baffles that maintain an air space between the insulation and the underside of the roof sheathing are absent and/or insulation is preventing proper venting. Adjustments are recommended.

-  12. Access to the attic area above the master bathroom was restricted because of this home's roof construction style. Therefore, this component and its features may possess latent defects that were not detected during the inspection, and they may not. In this instance, the full extent of the condition of this structural component cannot be determined from this limited visual inspection.

-  13. Roof was wet with rain at time of the inspection, which created a potentially unsafe condition for the inspector; and pursuant to ASHI inspection standards and the Scope of Inspection agreement, the roof was unable to be accessed. Consequently, representation about the condition of the roof and its related components cannot be made.










Visit our website, <http://www.national-inspection.com/anounceofprevention.html> for our article entitled: ***"An Ounce of Prevention: preventative maintenance checklist"*** for information about regular preventative home maintenance as well as several other articles that provide answers to questions on all subjects pertaining to home ownership.



How to Read this Report

*This report is organized by the property's functional areas. Report Terminology: Component marked **SATISFACTORY** – was functional at the time of inspection or in visible working or operating order and its condition was at least sufficient for its minimum required function; **FAIR** – requires, or has a probability of requiring, monitoring, maintenance, repair, replacement, and/or other remedial work now or in the near future; **POOR** – requires immediate repair, replacement, or other remedial work, or has a high probability of requiring such work in the immediate future, or requires further evaluation.*

	Safety Issues	A condition in a readily accessible, installed system or component that is judged to be a significant risk of personal injury during normal, day-to-day use. The risk may be due to damage, deterioration, improper installation or a change in accepted residential construction standards. Deficiency may lead to injury or death.
	Significantly Deficient	A condition that has a material defect that could affect the use or function of a structural system or component and/or cause consequential damage. Further evaluation by a specialized contractor may result in significant repair or replacement costs.
	Repair / Replace	An issue that requires repair or ongoing maintenance, is missing, or requires replacement.
	Further Evaluation	Examination and analysis by a qualified professional, tradesman or service technician beyond that provided by the home inspection and/or beyond the scope of the inspection as defined by National Inspection Services' Authorization and Contract for Residential Real Estate Inspection Services.
	Monitor	Denotes a system or component needing ongoing monitoring either by the customer or a qualified contractor, tradesman or structural engineer.
	Comment	Denotes a system or component that requires regular maintenance to assure safe, reliable operation or is just a comment that may be of special interest to the customer.
	Photo	A photograph is available or has been included with the report to help to visually identify an issue.

FOOTNOTES and DISCLAIMERS ⓘ

Foundation: ⁽¹⁾ Pursuant to inspection procedures that meet ASHI standards, the area was not entered due to circumstances, which created potentially unsafe conditions for the inspector. This limitation is addressed within our Authorization and Contract agreement.

Heating: This inspection does not include any evaluation of heat exchangers, which should be examined regularly by utility company personnel or a licensed heating contractor. We will not assume responsibility for any carbon monoxide leaks, which are not detected at time of inspection.

Electrical: Low voltage wiring and systems are not part of this inspection. We make no representations whatsoever about the characteristics of aluminum wiring. A certain amount of aluminum cable is typically found in any electrical system.

Plumbing: Performance of underground sprinkler systems, including cross connection devices, hot water heaters, water treatment systems, sewer lines, water lines & septic systems, and recreational facilities such as pools, saunas and spas, are not covered in this inspection and report. Also, concealed fittings, e.g., sillcocks, cannot be evaluated for latent defects.

Living Areas: General condition of walls and floors cannot be fully determined if they are covered by carpeting, wall hangings, paintings, wallpaper, etc., and defects are hidden.

Architectural Features: The intent is to inspect and operate a representative number of windows, doors, cabinetry, and other features.

Kitchen: Performance of household appliances is not covered in the inspection and this report.

Bathrooms: Moisture behind tiled surfaces may not be evident at time of inspection.

Attic: ⁽²⁾ Pursuant to inspection procedures that meet ASHI standards, attic was not walked or not walked in its entirety due to circumstances, which created potentially unsafe conditions for the inspector. This limitation is addressed within our Authorization and Contract agreement.

Roofing: intersections, where different roof surfaces and different materials meet, require periodical resealing and refastening. Roof features that were not inspected will not be described in this report. Inclement weather will prevent inspection of roofing. We do not certify roof longevity or the presence of "soft spots", and do not necessarily report on previous hail or weather occurrences. Skylights, if any, are susceptible to leakage and should be inspected periodically.

Roof Drainage: Gutter seams require periodical resealing and refastening. Gutters need to be re-sloped periodically for proper flow. Gutter rust is not evaluated.

This report does not necessarily constitute a soils or structural evaluation as may be required by Colorado state legislation, and is not to be constructed as a report by a Licensed Professional Engineer. We do not perform the laboratory, diagnostic, or other in-depth qualitative and quantitative studies unless specifically arranged for by contract. All stucco siding issues identified in this report require additional evaluation by an EDI certified stucco inspector. This inspection is intended to report on major architectural and mechanical components of the home, and we warn you that although the premises may be in satisfactory condition when examined, the condition may change thereafter. Our inspection process does not address cosmetic defects.

Our responsibility does not necessarily entail informing you of such items as:

1. Peeling paint or wallpaper, condition of floor coverings, or other defects in décor or furnishings or cabinetry, including warping of cabinet bottoms.
2. Water stains (unless the stain was wet when inspected, it cannot be diagnosed as a current or past problem), or hidden moisture problems, including the presence of mold.
3. Plaster or drywall cracks, unless they are caused by a structural defect.
4. Broken glass or screens; condition of fencing, landscaping features, or window seals.
5. Wood destroying insects, rodents, odors or nuisances including other pests, pet problems and neighborhood noise.
6. Unpredictable soil/water conditions which may result in volumetric changes and subsequent structural damage; subsidence or subsidence potential due to underground mines or caves.
7. Presence of Radon gas or other naturally occurring hazards or soil contamination.
8. Presence of current or future discovery of toxic materials, whether intentionally or unintentionally placed, such as asbestos, methamphetamine or PCS's (either above or belowground).
9. Condition of wells, pumps, water treatment equipment, irrigation equipment, solar equipment, ponds, and security equipment pipes and tanks both above and belowground.
10. Space planning or decorating and design faults and/or features including floor squeaks.

These items are the responsibility of the buyer. Furthermore, this report does not examine building code violations or any other code violations. In the event of obvious or suspected improvements to the property, we encourage our Customers to view the permit records for this property. Also, if water supply lines are determined to be plastic, it/they may be a polybutylene material. Historically, there is a greater than average chance of failure, i.e. leaks, with polybutylene material. For further information, please research fully. The Internet offers many resources regarding polybutylene. Additionally, intermittent failures or severe, uncontrolled natural conditions, acts of god, and extreme weather are not our responsibility. Compliance with lender's evaluation criteria is not our responsibility. We do not examine agricultural buildings or structures intended for animal housing.

CUSTOMER: Todd Lambert and Tricia L. Lambert
4210 Brian Place
Carmel, IN 46033

COPIES TO: Julie Perisch, The Group Inc.
COST OF COPIES: no charge

THANK YOU,

Dave Tokarz

DAVID C. TOKARZ, PRESIDENT
NATIONAL INSPECTION SERVICES – RESIDENTIAL
a division of Synergy Enterprises, Inc.

ADDENDUMS: Acceptance of the Report shall constitute acceptance of the terms of the following:
"Authorization and Contract for Residential Real Estate Inspection Services" enclosed: Yes No ___
"Real Estate Inspection Terms and Conditions" enclosed: Yes No ___
Disclaimer form entitled "Addendum to Attached Building Inspection Report" enclosed: Yes No ___
Disclaimer form entitled "Limitation of Warranty of Inspector's Work Product" enclosed: Yes No ___
Disclaimer form entitled "Partially Snow Covered Structural Components" enclosed: Yes No ___

Date: **6/14/2010**

This report has been prepared for the exclusive use of the above named customer only and any other use is unauthorized.



Certified ASHI Inspector #212456

